

ARDEX WPM 501 - PART B

Chemwatch Material Safety Data Sheet
Issue Date: 11-Mar-2006

Revision No: 2

Hazard Alert Code:
MODERATE

Chemwatch 4560-92
CD 2006/2

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION**PRODUCT NAME:** ARDEX WPM 501 - PART B**SYNONYMS**

"Shelter HydrEpoxy 501 Adhesive -Part B"

PRODUCT USE

Requires that the two parts be mixed by hand or mixer before use, in accordance with manufacturers directions. Mix only as much as is required. Do not return the mixed material to the original containers. Part B of a two component water-based epoxy adhesive.

SUPPLIER

Company: Ardex Australia Pty Ltd
Address:
20 Powers Road
Seven Hills
NSW, 2147
AUS
Telephone: 1800 224 070
Fax: +61 2 9838 7817

HAZARD RATINGS

	Min	Max
Flammability:	0	
Toxicity:	2	
Body Contact:	2	
Reactivity:	1	
Chronic:	2	

Min/Nil=0
Low=1
Moderate=2
High=3
Extreme=4

**Section 2 - HAZARDS IDENTIFICATION****STATEMENT OF HAZARDOUS NATURE**

HAZARDOUS SUBSTANCE. NON-DANGEROUS GOODS. According to the Criteria of NOHSC, and the ADG Code.

POISONS SCHEDULE

S5

RISK

Harmful by inhalation, in contact with skin and if swallowed.
Irritating to eyes and skin.
May cause SENSITISATION by skin contact.
Toxic to aquatic organisms, may cause long-term adverse effects in the aquatic environment.
May produce discomfort of the respiratory system*.
Possible respiratory sensitiser*.
May possibly affect fertility*.
* (limited evidence).

SAFETY

Keep container in a well ventilated place.
Avoid exposure - obtain special instructions before use.
Keep container tightly closed.
Take off immediately all contaminated clothing.
In case of contact with eyes, rinse with plenty of water and contact Doctor or Poisons Information Centre.

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
bisphenol A/ epichlorohydrin resin, liquid	25068-38-6	30-60
ingredients determined not to be hazardous		40-70

Section 4 - FIRST AID MEASURES**SWALLOWED**

- Immediately give a glass of water.
- First aid is not generally required. If in doubt, contact a Poisons Information Centre or a doctor.

EYE

If this product comes in contact with the eyes:

- Wash out immediately with fresh running water.
- Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
- If pain persists or recurs seek medical attention.
- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

ARDEX WPM 501 - PART B

Chemwatch Material Safety Data Sheet
Issue Date: 11-Mar-2006

Revision No: 2

Hazard Alert Code:
MODERATE
Chemwatch 4560-92
CD 2006/2

SKIN

If skin contact occurs:

- Immediately remove all contaminated clothing, including footwear
- Flush skin and hair with running water (and soap if available).
- Seek medical attention in event of irritation.

INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor.

NOTES TO PHYSICIAN

Treat symptomatically.

Section 5 - FIRE FIGHTING MEASURES**EXTINGUISHING MEDIA**

- There is no restriction on the type of extinguisher which may be used.
- Use extinguishing media suitable for surrounding area.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves for fire only.
- Prevent, by any means available, spillage from entering drains or water courses.
- Use fire fighting procedures suitable for surrounding area.
- DO NOT approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.
- Equipment should be thoroughly decontaminated after use.

FIRE/EXPLOSION HAZARD

- Non combustible.
 - Not considered a significant fire risk, however containers may burn.
- Decomposition may produce toxic fumes of, carbon dioxide (CO₂), aldehydes, other pyrolysis products typical of burning organic material.

May emit poisonous fumes.

May emit corrosive fumes.

FIRE INCOMPATIBILITY

Avoid contamination with oxidising agents i.e. nitrates, oxidising acids, chlorine bleaches, pool chlorine etc. as ignition may result.

HAZCHEM

None

Personal Protective Equipment

Breathing apparatus.

Gas tight chemical resistant suit.

Limit exposure duration to 1 BA set 30 mins.

Section 6 - ACCIDENTAL RELEASE MEASURES**EMERGENCY PROCEDURES****MINOR SPILLS**

- Clean up all spills immediately.
- Avoid breathing vapours and contact with skin and eyes.
- Control personal contact by using protective equipment.
- Contain and absorb spill with sand, earth, inert material or vermiculite.
- Wipe up.
- Place in a suitable labelled container for waste disposal.

MAJOR SPILLS

Moderate hazard.

- Clear area of personnel and move upwind.
- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves.
- Prevent, by any means available, spillage from entering drains or water course.
- Stop leak if safe to do so.
- Contain spill with sand, earth or vermiculite.
- Collect recoverable product into labelled containers for recycling.
- Neutralise/decontaminate residue.
- Collect solid residues and seal in labelled drums for disposal.
- Wash area and prevent runoff into drains.
- After clean up operations, decontaminate and launder all protective clothing and equipment before storing and re-using.
- If contamination of drains or waterways occurs, advise emergency services.

EMERGENCY RESPONSE PLANNING GUIDELINES (ERPG)

The maximum airborne concentration below which it is believed that nearly all individuals could be exposed for up to one hour WITHOUT experiencing or developing

ARDEX WPM 501 - PART B

Chemwatch Material Safety Data Sheet

Revision No: 2

**Hazard Alert Code:
MODERATE**

Chemwatch 4560-92

Issue Date: 11-Mar-2006

CD 2006/2

life-threatening health effects is:

bisphenol A/ epichlorohydrin
resin, liquid 500 mg/m³

irreversible or other serious effects or symptoms which could impair an individual's ability to take protective action is:

bisphenol A/ epichlorohydrin
resin, liquid 50 mg/m³

other than mild, transient adverse effects without perceiving a clearly defined odour is:

bisphenol A/ epichlorohydrin
resin, liquid 30 mg/m³

The threshold concentration below which most people will experience no appreciable risk of health effects:

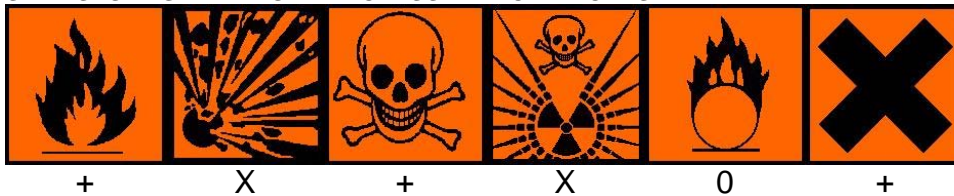
bisphenol A/ epichlorohydrin
resin, liquid 10 mg/m³

American Industrial Hygiene Association (AIHA)

Ingredients considered according exceed the following cutoffs

Very Toxic (T+)	>= 0.1%	Toxic (T)	>= 3.0%
R50	>= 0.25%	Toxic (T)	>= 3.0%
R51	>= 2.5%	Corrosive (C)	>= 5.0%
else	>= 10%		

where percentage is percentage of ingredient found in the mixture

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS

X: Must not be stored together

O: May be stored together with specific preventions

+: May be stored together

Personal Protective Equipment advice is contained in Section 8 of the MSDS.**Section 7 - HANDLING AND STORAGE****PROCEDURE FOR HANDLING**

- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Avoid contact with moisture.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately. Launder contaminated clothing before re-use.
- Use good occupational work practice.
- Observe manufacturer's storing and handling recommendations.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.

DO NOT allow clothing wet with material to stay in contact with skin.

SUITABLE CONTAINER

- Polyethylene or polypropylene container.
- Packing as recommended by manufacturer
- Check all containers are clearly labelled and free from leaks.

STORAGE INCOMPATIBILITY

Avoid reaction with amines, mercaptans, strong acids and oxidising agents.

STORAGE REQUIREMENTS

- Store in original containers.
- Keep containers securely sealed.
- Store in a cool, dry, well-ventilated area.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations.

ARDEX WPM 501 - PART B

Chemwatch Material Safety Data Sheet
Issue Date: 11-Mar-2006

Revision No: 2

Hazard Alert Code:
MODERATE

Chemwatch 4560-92
CD 2006/2

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION**EXPOSURE CONTROLS**

The following materials had no OELs on our record under the following CAS or Chemwatch (CW) numbers
Ardex WPM 501 - Part B: No data available for CW:4560-92
bisphenol A/ epichlorohydrin resin, liquid: No data available for CAS:25068-38-6 CAS:25085-99-8

EMERGENCY EXPOSURE LIMITS**ODOUR SAFETY FACTOR (OSF)**

OSF=0.54 (bisphenol A/ epichlorohydrin resin, liquid)

Exposed individuals are NOT reasonably expected to be warned, by smell, that the Exposure Standard is being exceeded.

Odour Safety Factor (OSF) is determined to fall into either Class C, D or E.

The Odour Safety Factor (OSF) is defined as:

OSF= Exposure Standard (TWA) ppm/ Odour Threshold Value (OTV) ppm

Classification into classes follows:

Class	OSF	Description
A	550	Over 90% of exposed individuals are aware by smell that the Exposure Standard (TLV-TWA for example) is being reached, even when distracted by working activities
B	26-550	As "A" for 50-90% of persons being distracted
C	1-26	As "A" for less than 50% of persons being distracted
D	0.18-1	10-50% of persons aware of being tested perceive by smell that the Exposure Standard is being reached
E	<0.18	As "D" for less than 10% of persons aware of being tested

INGREDIENT DATA

BISPHENOL A/ EPICHLOROHYDRIN RESIN, LIQUID:

No exposure limits set by NOHSC or ACGIH.

PERSONAL PROTECTION**EYE**

- Safety glasses with side shields.
- Chemical goggles.
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59]

HANDS/FEET

- When handling liquid-grade epoxy resins wear chemically protective gloves (e.g nitrile or nitrile-butadiene rubber), boots and aprons.
- DO NOT use cotton or leather (which absorb and concentrate the resin), polyvinyl chloride, rubber or polyethylene gloves (which absorb the resin).
- DO NOT use barrier creams containing emulsified fats and oils as these may absorb the resin; silicone-based barrier creams should be reviewed prior to use.

Wear chemical protective gloves, eg. PVC.

Wear safety footwear or safety gumboots, eg. Rubber.

NOTE: The material may produce skin sensitisation in predisposed individuals. Care must be taken, when removing gloves and other protective equipment, to avoid all possible skin contact.

OTHER

- Overalls.
- P.V.C. apron.
- Barrier cream.
- Skin cleansing cream.
- Eye wash unit.

RESPIRATOR

Selection of the Class and Type of respirator will depend upon the level of breathing zone contaminant and the chemical nature of the contaminant. Protection Factors (defined as the ratio of contaminant outside and inside the mask) may also be important.

Breathing Zone Level ppm (volume)	Maximum Protection Factor	Half-face Respirator	Full-Face Respirator

ARDEX WPM 501 - PART B**Hazard Alert Code:
MODERATE**

Chemwatch Material Safety Data Sheet

Revision No: 2

Chemwatch 4560-92

Issue Date: 11-Mar-2006

CD 2006/2

1000	10	A-AUS P	-
1000	50	-	A-AUS P
5000	50	Airline *	-
5000	100	-	A-2 P
10000	100	-	A-3 P
	100+		Airline**

* - Continuous Flow ** - Continuous-flow or positive pressure demand.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

ENGINEERING CONTROLS

Local exhaust ventilation usually required. If risk of overexposure exists, wear approved respirator. Correct fit is essential to obtain adequate protection. Supplied-air type respirator may be required in special circumstances. Correct fit is essential to ensure adequate protection.

An approved self contained breathing apparatus (SCBA) may be required in some situations.

Provide adequate ventilation in warehouse or closed storage area. Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

Type of Contaminant:

Air Speed:

solvent, vapours, degreasing etc., evaporating from tank (in still air).

0.25-0.5 m/s (50-100 f/min.)

aerosols, fumes from pouring operations, intermittent container filling, low speed conveyer transfers, welding, spray drift, plating acid fumes, pickling (released at low velocity into zone of active generation)

0.5-1 m/s (100-200 f/min.)

direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion)

1-2.5 m/s (200-500 f/min.)

grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion).

2.5-10 m/s (500-2000 f/min.)

Within each range the appropriate value depends on:

Lower end of the range

Upper end of the range

1: Room air currents minimal or favourable to capture

1: Disturbing room air currents

2: Contaminants of low toxicity or of nuisance value only.

2: Contaminants of high toxicity

3: Intermittent, low production.

3: High production, heavy use

4: Large hood or large air mass in motion

4: Small hood-local control only

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 1-2 m/s (200-400 f/min) for extraction of solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES**APPEARANCE**

White paste with a mild epoxy odour; emulsifies in water.

PHYSICAL PROPERTIES

Liquid.

Molecular Weight: Not Applicable

Boiling Range (°C): 100

Melting Range (°C): Not Available

Specific Gravity (water=1): 1.05-1.09

Solubility in water (g/L): Partly Miscible

pH (as supplied): 8

pH (1% solution): Not Available

Vapour Pressure (kPa): Not Available

Volatile Component (%vol): 35-40

Evaporation Rate: Not Available

Relative Vapour Density (air=1): Not Available

Flash Point (°C): Not Applicable

Lower Explosive Limit (%): Not Applicable

Upper Explosive Limit (%): Not Applicable

Autoignition Temp (°C): Not Applicable

Decomposition Temp (°C): Not Available

State: Liquid

Viscosity: Not Available

Section 10 - CHEMICAL STABILITY AND REACTIVITY INFORMATION**CONDITIONS CONTRIBUTING TO INSTABILITY**

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

Section 11 - TOXICOLOGICAL INFORMATION

ARDEX WPM 501 - PART B**Hazard Alert Code:
MODERATE**

Chemwatch Material Safety Data Sheet

Revision No: 2

Chemwatch 4560-92

Issue Date: 11-Mar-2006

CD 2006/2

POTENTIAL HEALTH EFFECTS**ACUTE HEALTH EFFECTS****SWALLOWED**

The material is not thought to produce adverse health effects following ingestion (as classified by EC Directives using animal models). Nevertheless, adverse systemic effects have been produced following exposure of animals by at least one other route and good hygiene practice requires that exposure be kept to a minimum.

EYE

The material may produce severe irritation to the eye causing pronounced inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis.

SKIN

Skin contact with the material may damage the health of the individual; systemic effects may result following absorption.

This material can cause inflammation of the skin on contact in some persons.

The material may accentuate any pre-existing dermatitis condition.

Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects.

Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.

INHALED

Inhalation of vapours or aerosols (mists, fumes), generated by the material during the course of normal handling, may be harmful.

There is some evidence to suggest that the material can cause respiratory irritation in some persons. The body's response to such irritation can cause further lung damage.

CHRONIC HEALTH EFFECTS

There is some evidence that inhaling this product is more likely to cause a sensitisation reaction in some persons compared to the general population.

Skin contact with the material is more likely to cause a sensitisation reaction in some persons compared to the general population.

There is some evidence from animal testing that exposure to this material may result in toxic effects to the unborn baby.

Sensitisation may give severe responses to very low levels of exposure, i.e. hypersensitivity. Sensitised persons should not be allowed to work in situations where exposure may occur.

Bisphenol A may have effects similar to female sex hormones and when administered to pregnant women, may damage the foetus. It may also damage male reproductive organs and sperm.

Sensitisation may result in allergic dermatitis responses including rash, itching, hives or swelling of extremities.

TOXICITY AND IRRITATION

Not available. Refer to individual constituents.

unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances

TOXICITY**IRRITATION****BISPHENOL A/ EPICHLOROHYDRIN RESIN, LIQUID:**

Oral (rat) LD50: 11400 mg/kg

Eye (rabbit): 100 mg Mild

Section 12 - ECOLOGICAL INFORMATION

Do NOT allow product to come in contact with surface waters or to intertidal areas below the mean high water mark. Do not contaminate water when cleaning equipment or disposing of equipment wash-waters.

Wastes resulting from use of the product must be disposed of on site or at approved waste sites.

DO NOT discharge into sewer or waterways.

Refer to data for ingredients, which follows:

BISPHENOL A/ EPICHLOROHYDRIN RESIN, LIQUID:

Do NOT allow product to come in contact with surface waters or to intertidal areas below the mean high water mark. Do not contaminate water when cleaning equipment or disposing of equipment wash-waters.

Wastes resulting from use of the product must be disposed of on site or at approved waste sites.

DO NOT discharge into sewer or waterways.

Section 13 - DISPOSAL CONSIDERATIONS

- Recycle wherever possible.
- Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.
- Dispose of by: Burial in a licenced land-fill or Incineration in a licenced apparatus (after admixture with suitable combustible material)
- Decontaminate empty containers. Observe all label safeguards until containers are cleaned and destroyed.

If container can not be cleaned sufficiently well to ensure none of the original product remains or if the container cannot be used to store the same product, then puncture containers, to prevent re-use, and bury at an authorised landfill.

Section 14 - TRANSPORTATION INFORMATION**HAZCHEM**

None

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS:UN,IATA,IMDG

Section 15 - REGULATORY INFORMATION**POISONS SCHEDULE**

S5

REGULATIONS

ARDEX WPM 501 - PART B

Chemwatch Material Safety Data Sheet

Revision No: 2

**Hazard Alert Code:
MODERATE**

Chemwatch 4560-92

Issue Date: 11-Mar-2006

CD 2006/2

bisphenol A/ epichlorohydrin resin, liquid (CAS: 25068-38-6) is found on the following regulatory lists;

Australia Inventory of Chemical Substances (AICS)

Australia Poisons Schedule

OECD Representative List of High Production Volume (HPV) Chemicals

bisphenol A/ epichlorohydrin resin, liquid (CAS: 25085-99-8) is found on the following regulatory lists;

Australia Inventory of Chemical Substances (AICS)

Australia Poisons Schedule

OECD Representative List of High Production Volume (HPV) Chemicals

Section 16 - OTHER INFORMATION**Ingredients with multiple CAS Nos**

Ingredient Name

CAS

bisphenol A/ epichlorohydrin resin, liquid

25068-38-6, 25085-99-8

This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

Issue Date: 11-Mar-2006

Print Date: 7-Jun-2006